



Gnomes

Modified from Rebecca DeGroot video


Start with wood that is 50 x 50 x 200. Or larger or smaller if you wish. Plain wood is fine as part of the body will be covered with a beard and the hat may be decorated.

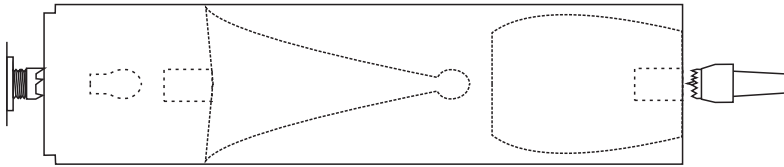


Mount between centres, make it almost round and cut a spigot for chuck mounting on one end.

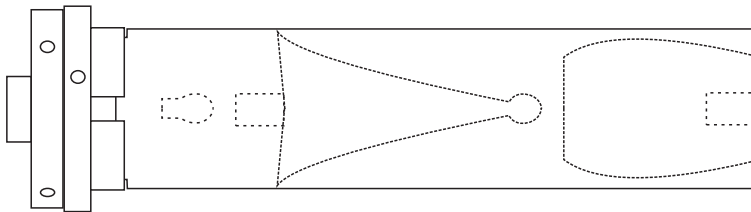



Make it all nicely round and drill a 10mm hole about 20mm into the end.

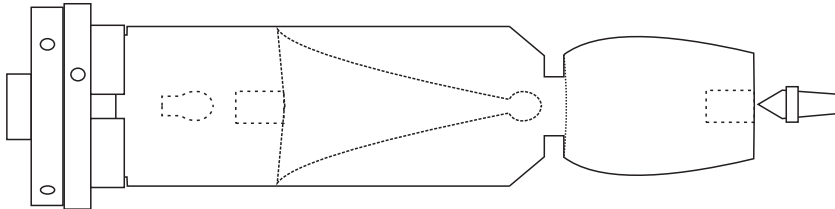



Bring up the tailstock to keep the outer end steady. Cut and shape the body of the gnome to be about 60mm long and 45mm diameter. Start the parting-off cut then sand all the body and the start of the parting cut. Ensure that the parting cut is slightly concave. Complete the parting off.

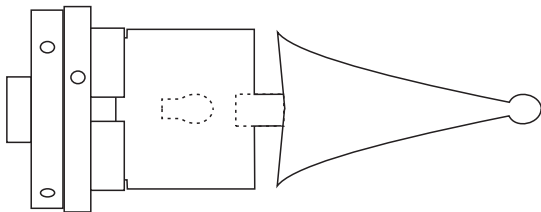


Shape the hat to be about 80mm tall and start the parting-off cut. Sand and finish this area.

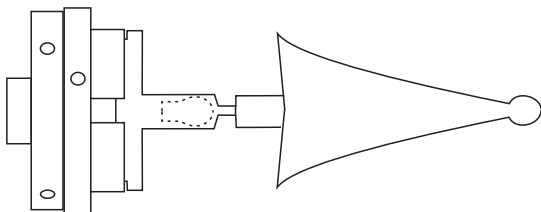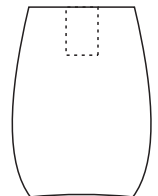

Turn the stem below the hat to about 9.5mm diameter (or a size to fit the first hole drilled) and the remainder of the shaft towards the chuck down to about 11mm dia. Part the hat off.

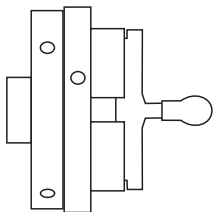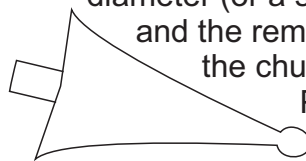

Turn a sphere about 10mm dia with a 6mm dia shaft for the nose. Sand and finish the round end. Part it off.

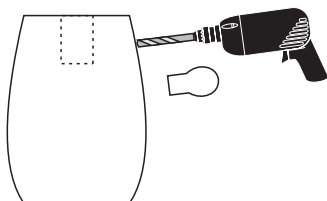

Freehand drill a hole to fit the shaft of the nose. Glue the nose in. Glue the hat on. Add colour, a beard or decoration of your choice.

