



## PENDANT JEWELLERY 3


This is to make a pendant which is triangular when viewed and oval in cross-section. It may be of pretty wood or have embellishments added. The wood is a 50% scale.

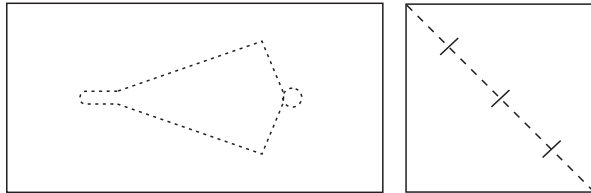


Start with a block that is 50 x 50 x 200mm. Mark the ends with a centre and 20mm offsets on one diagonal.

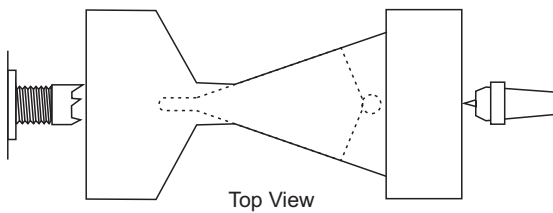


Mount the wood between centres. The ends need to remain square so mark that 20mm in from each end. Cut the centre part round and down to the shape of the pendant. But leave some extra wood at the thin end to support the off-centre turning. Draw a line on both sides of the turned cone between the non-offset corners at both ends.

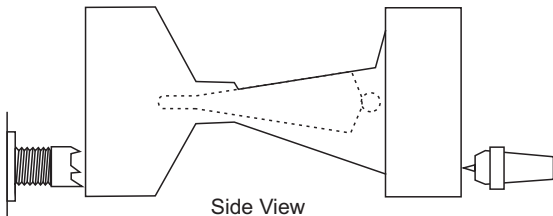


Remount the wood by one off-set. Turn that side down to exactly the pencil line at the wide end, but stay a couple of millimetres away from the pencil line towards the narrow end of the part you are cutting. This edge can be sanded on both sides to meet later.

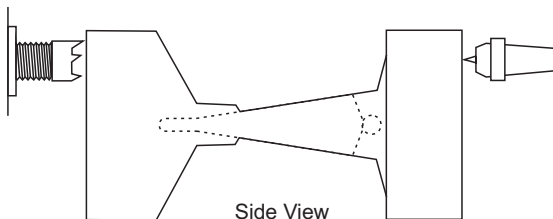

Remount on the other off-set and cut that side equally.

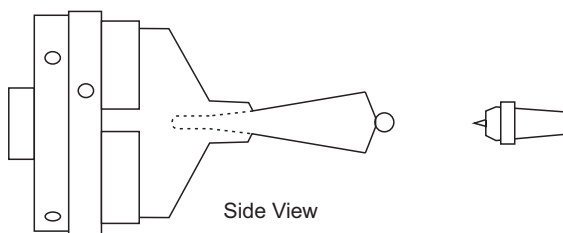

Remount the wood in a chuck and bring up the tailstock to ensure good alignment and support. Cut the tailstock end of the wood away. Sand and finish the bottom end of the pendant.

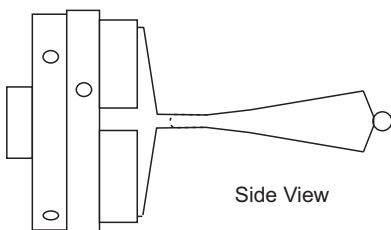

Cut the upper end of the pendant thinner. The narrow end needs to be shaped to fit a pendant clip or a hole drilled for a ring. Sand and finish all surfaces. It may be easier to add embellishment while it is held in the chuck. Part off.

